
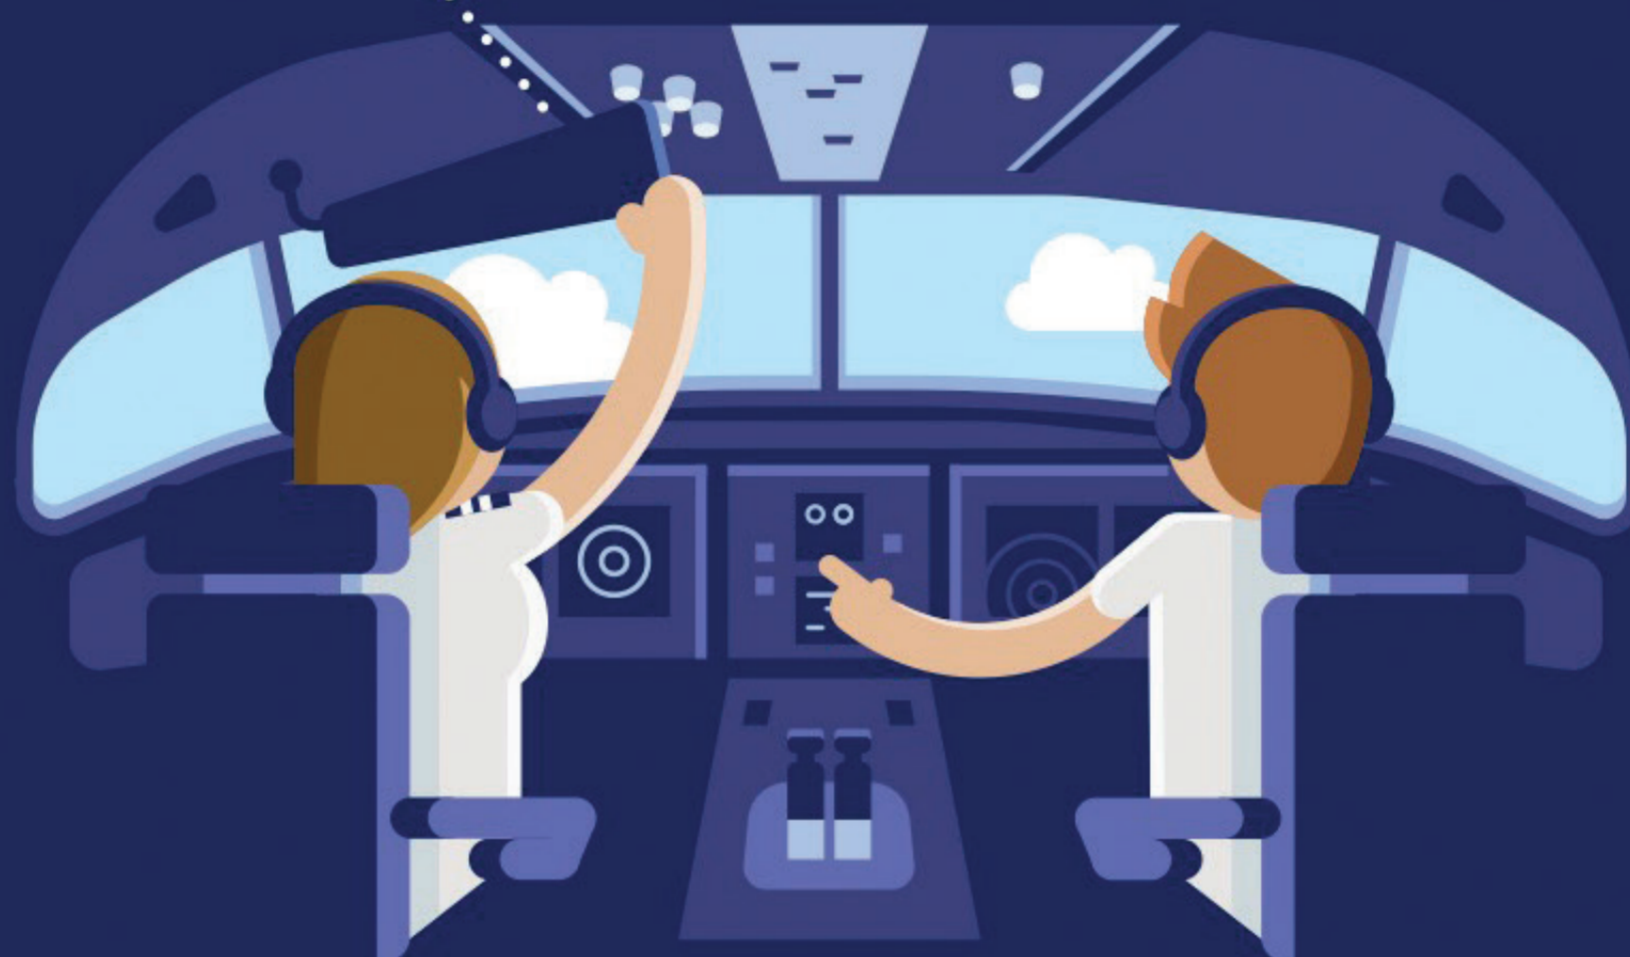


Make safety our shared destination

Safety Experience

Inadvertent overhead panel switches activation when using sun visors

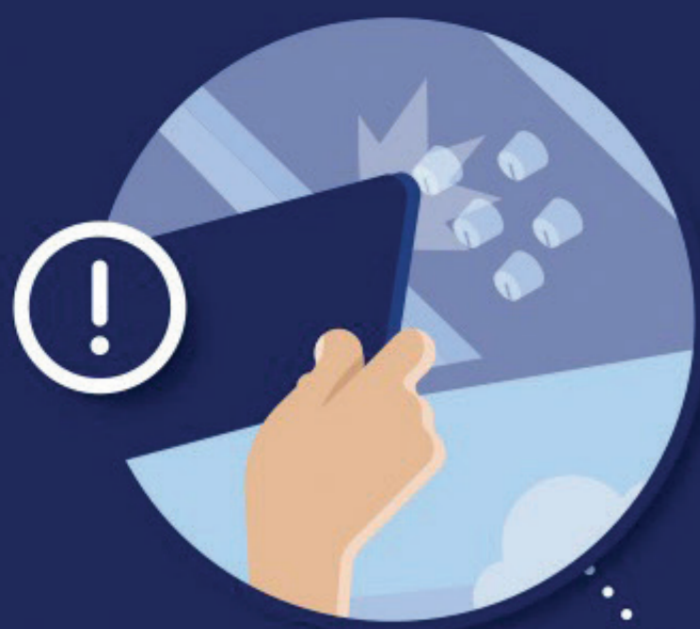

! Potential effects

-  Loss of ADIRS
-  RAT deployment
-  Loss of some flight envelope protections

✓ Recommendations

-  Handle sun visor with care
-  Report cases of free rotation of ADIRS switches
-  Remain mindful of inadvertent control activation inside the cockpit
-  In case of inadvertent switch activation: follow ECAM and QRH checklists with active crosscheck during recovery procedures
-  Report any anomalies on cockpit controls



Find out more on
d10x.airbus.com



AIRBUS